


TROUBLESHOOTING

Problem - computer not turning on (no picture on monitor, CPU fan not spinning)
The motherboard battery may have died. First, verify that 12 volts is present at the power connector feeding the motherboard (Black wire=ground, White wire=+12v)

If power is good, then use a small screwdriver and momentarily jumper the ON/OFF pins on the PANEL1 connector on the lower corner of the motherboard.

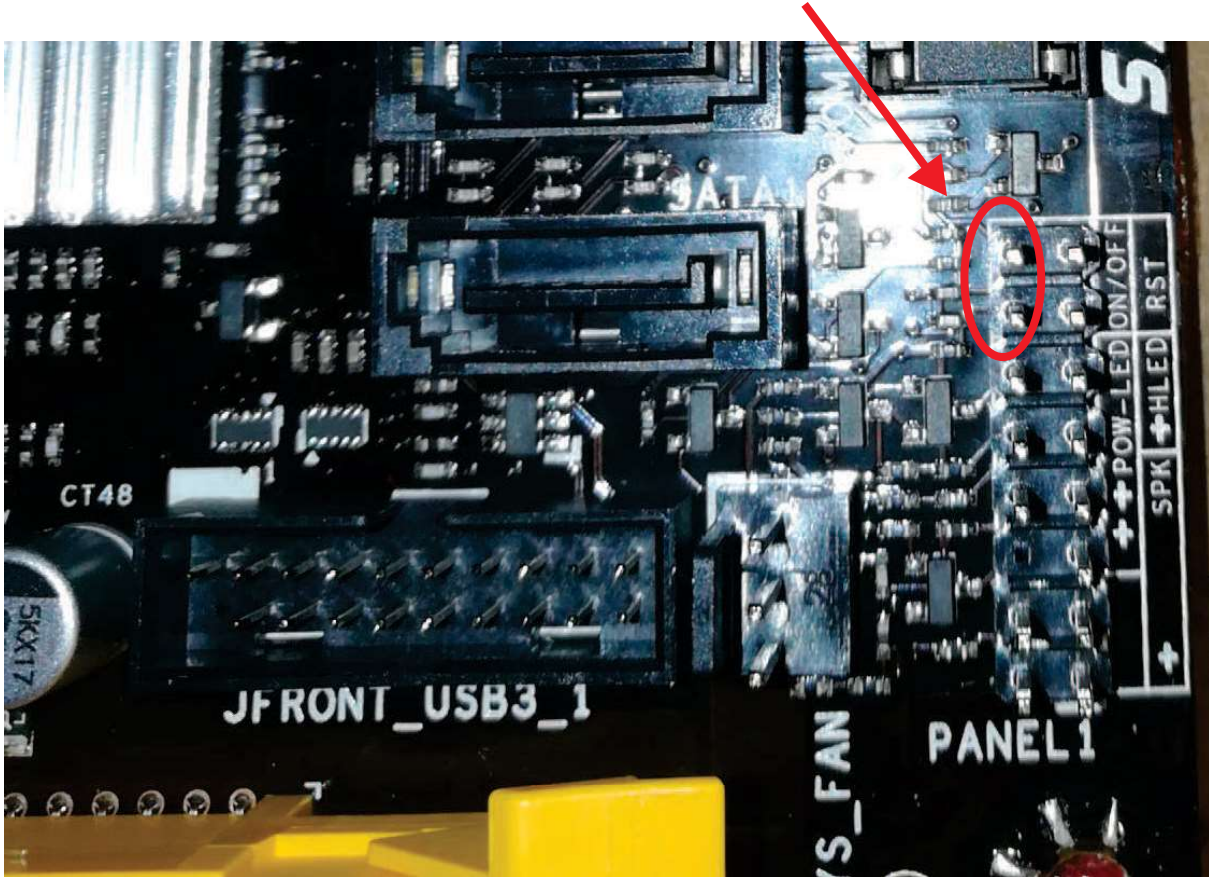

If the motherboard and PICO PSU power supply are good, then the fan on the CPU should turn on and an image should appear on the monitor.

Make sure the monitor is turned on - if the motherboard is off for some time then the monitor will go into power save and shut itself off.

If the monitor is on, and the CPU fan is spinning but there is still no picture, check your cables and verify that the monitor is set for HDMI input (some of them default at VGA when first installed).

Still no picture ? Unplug the computer and carefully remove the memory module from its socket and re-insert it.

Restore power and try jumpering the ON/OFF pins again. If still no picture you probably have a bad motherboard, contact Elaut USA for further support.

